

QUALITY SYSTEMS & CALIBRATIONS PVT. LTD.

Plot No. S-152, S Block, Indrayani Nagar Road, MIDC, Bhosari, Pune - 411026. INDIA. Tel: 020-27167000 E-MAIL: qc@elcalabs.com WEB: www.elcalabs.com



TEST REPORT

Page: 1/1

GULMOHAR PACKTECH INDIA PVT.LTD.

Sr.No.80/11, Plot no.:1, Bhosari-Alandi Road, Dighi-Magzine chowk, Behind Pragati hotel-412 105

| REPORT NO | A/19/7183/P | DATE 30.04.2019 |
|-------------------|------------------|------------------------|
| YOUR CHALLAN NO | | |
| YOUR CHALLAN DT. | 26.04.2019 | |
| SAMPLE RECD. DATE | 26.04.2019 | |
| ULR NO. | TC57441900002766 | 4F |

Material Description:

VCI(VOLATILE CORROSION INHIBITOR)BAG 100 MICRON THK., YELLOW COLOR

STANDARD SPECIFICATION

Samples not drawn by Elca

The above sample has been tested and the results are as below:

DISCIPLINE - CHEMICAL

GROUP

- METALLIC COATINGS & TREATMENT SOLUTIONS

SALT SPRAY TEST

TEST METHOD ASTM B 117: 2018

TEST AT :

PUNE

TEST DATE: 30.04.2019

| S.N | Parameter / Description | Actual Values | Specification Req. | Remark |
|-----|--------------------------------------|-----------------|---|--|
| 1 | Loading Date | 27.04.2019 | | • |
| 2 | Unloading Date | 30.04.2019 | • 1000000000000000000000000000000000000 | 3 - |
| 3 | Protection/Coating | Not used | - | |
| 4 | Method of Supporting | Nylon thread | - | _ |
| 5 | Temperature within Exposure Zone | 34.7 to 35.3°C | | |
| 6 | Exposure Period | 72hrs | | - |
| 7 | Salt Solution | 5.00 to 5.09% | | - |
| 8 | Type of Salt | NaCl (AR grade) | | - |
| 9 | Type of Water | Distilled water | - | |
| 10 | Fog Collection Volume in ml/hr/80cm2 | 1.7 to 1.9 | | .=0 |
| 11 | Fog Collection Sp Gravity | 1.030 to 1.031 | | - |
| 12 | Fog Collection pH | 6.73 to 6.99 | - | |
| 13 | Method of Cleaning | Running Water | | in the second se |
| 14 | << Period in Hrs >> | | - | << Observation >> |
| 15 | 72 | | - | No Rust Observed. |

Interruption in exposure - Not Observed.

Annexure Attached

END OF REPORT-

For ELCA QUALITY SYSTEMS & CALIBRATIONS PVT. LTD.

Mohini Chavan

Authorised Signatory

A.B.KULKARNI/M.S.PHADAKE 1

QUALITY MANAGER/DY.TECH.MANAGER

E-MAIL: qc@elcalabs.com WEB: www.elcalabs.com

Plot No. S-152, S Block, Indrayani Nagar Road, MIDC, Bhosari, Pune - 411026. INDIA.



SALT SPRAY TEST

ELCA Report No: A/19/7184/P


Test Method : ASTM B117 (2018)

Date:30/04/2019

Annexure



(BEFORE TEST)

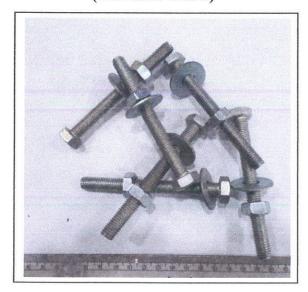

(AFTER72HRS)

Checked By Mohini Chavan

Authorized Signatory

M.S.PHADAKE

Format: EQC/5.10/1